
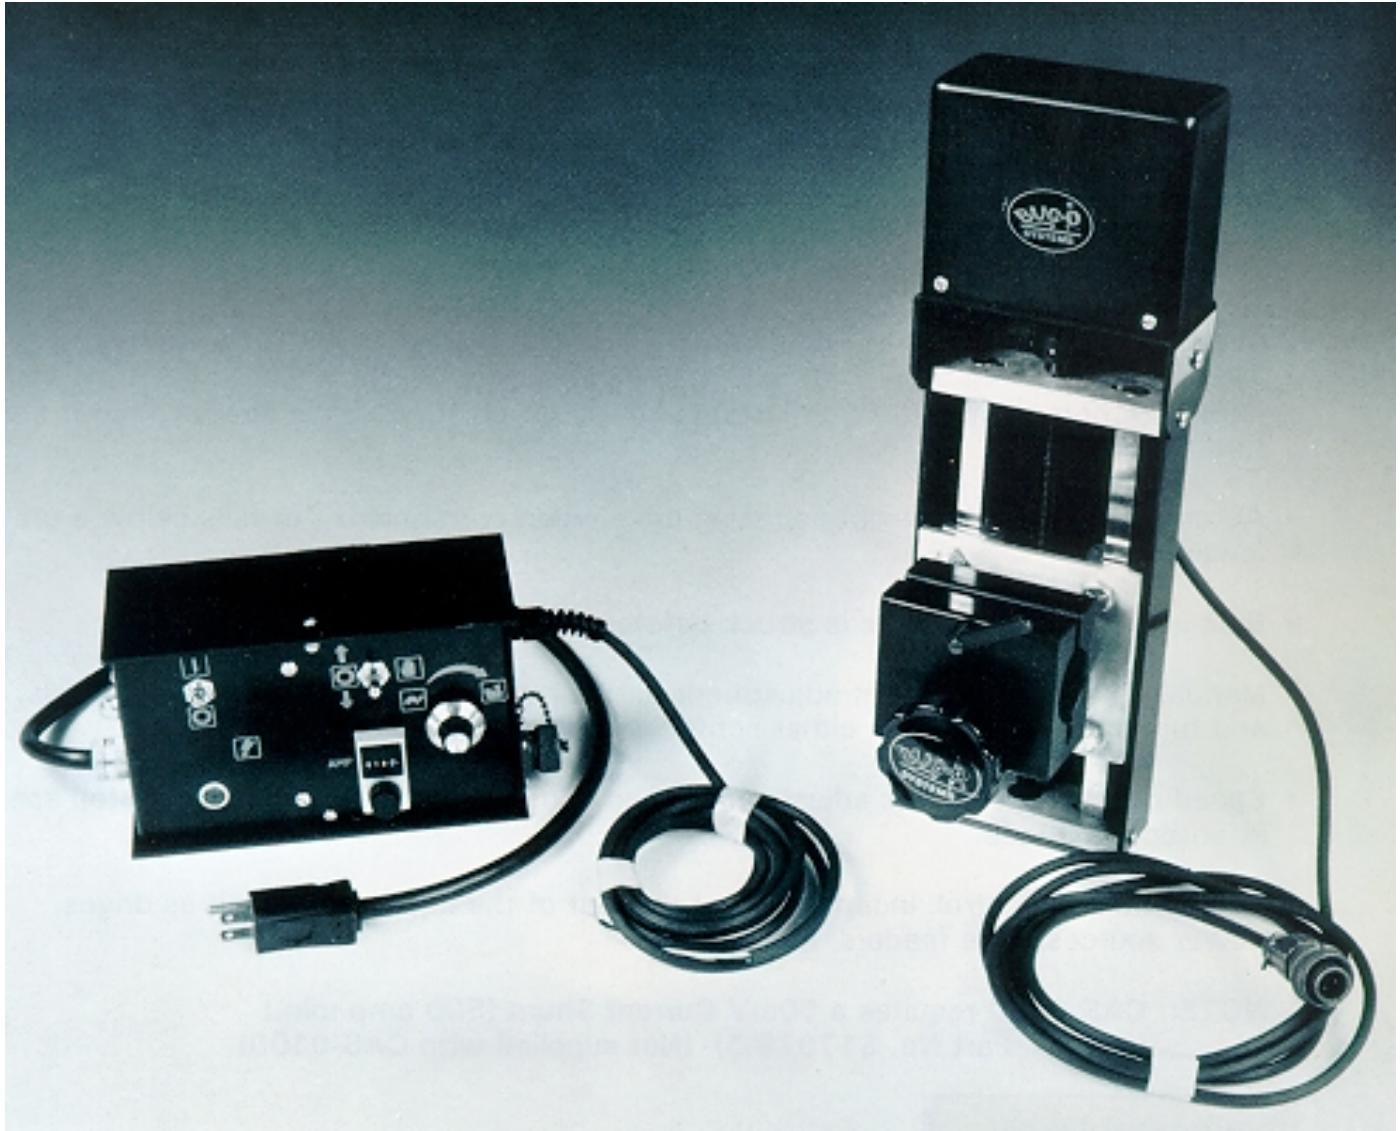


Affordable Automation
for Welding, Cutting and
Semi-Automatic Processes

AUTOMATIC HEIGHT CONTROL



The **CAS-0100 AUTOMATIC HEIGHT CONTROL** is a compact, easy to use accessory for Bug-O Systems equipment which is designed to maintain a constant welding torch-to-work distance. This control can be used with Sub Arc, Innershield and MIG welding. It includes a solid-state control box and a motorized slide which will bolt onto any standard Bug-O Systems carriage and can be used for a wide variety of welding applications where a constant arc length is critical. This system requires a constant voltage (CV) power supply for operation.

PATENTS WORLDWIDE



BUG-O SYSTEMS
A DIVISION OF WELD TOOLING CORPORATION



3001 WEST CARSON STREET PITTSBURGH, PENNSYLVANIA USA 15204-1899
PHONE: 1-800-245-3186 <http://www.bugo.com> TELEFAX: 1-412-331-0383



AUTOMATIC HEIGHT CONTROL

With the CAS-0100 the actual weld current is sensed continuously by means of a current shunt, 50mV full scale. The signal is filtered, amplified and compared to a set point value. Any error is fed to a second order control loop which sends a velocity signal to the height adjustment drive.

The control holds the error to zero for a flat piece of work, or for a weld with a uniform rise along its length. The drive for the motor is a four-quadrant servo control which enables smooth accurate height corrections. Therefore, the control can easily follow contours.

In addition to BUG-O carriages, the CAS-0100 can be used on fixtures or manipulators to provide constant wire stick-out length.

It provides automatic control of welding torch-to-work distance with the following:

- Multi-turn potentiometer, for adjusting current set point, which is directly read from a turn-counting dial.
- Automatic shut-off of height-adjusting drive when current is off or falls below a pre-set lower limit.
- Built-in time delay after arc is struck before drive activation.
- Manual up-and-down height adjustment buttons which override automatic controls, and function when drive is either active or inactive.
- Speed potentiometer sets adjustment speed in manual mode and also limits top speed in automatic mode.
- Self-contained control, independent of the rest of the equipment, such as drives, power sources, wire feeders, etc.

**NOTE: CAS-0100 requires a 50mV Current Shunt (500 amp min.)
BUG-O Part No. S17078-5) (Not supplied with CAS-0100)**

Technical Data:

Power Requirements:

CAS-0100	120 VAC/50-60HZ/1PH
CAS-0102	240 VAC/50-60HZ/1PH
CAS-0104	42 VAC/50-60HZ/1PH

Vertical Travel: 4" (100 mm)

Load Capacity: 20 lb (9.1 kg) within 4" (100 mm) of the slide's mounting plate.
The slide uses a slip clutch to protect the motor from overloads.

Net Weight:	Slide:	9 lb. (4.1 kg)
	Control Box:	6 lb (2.7 kg)

Dimensions:	Slide:	5.00"W x 15.25"H x 2.38"D (127 mm x 387 mm x 60 mm)
	Control Box:	8.00"W x 4.50"H x 3.63"D (203 mm x 114 mm x 92 mm)